

## WHITE OUTDOOR SERVICE BULLETIN DATE: APT 11 22, 1994

CODE: W-081

ROTATING

SCREEN

753-0603

SUBJECT:

Models 134T676G190 (LT-16) and 134T696H190 (LT-165) -

Possible Fuel Leakage

PROBLEM:

Reports from the field indicate potential fuel leakage which could lead to a fire hazard on White Outdoor models 134T676G190 and 134T696H190. Under certain circumstances the fuel tank could make contact with the rotating engine screen. This contact could cause the fuel tank to

develop a leak.

SOLUTION: Install Service Kit 753-0603. FUEL TANK

Service Kit 753-0603 Consists of:

711-0993 (1) Pin 1/4" Dia. x 1.43" Lg.

720-0238 (1) Plastic Cap

712-0271 (1) Hex Sems Nut 1/4-20 Thd.

(1) Green "X" Label

770-8812J (1) Instruction Sheet

Tools Required:

(1) 7/16" Wrench

(1) 1/2" Wrench\*

\* May be required

## INSTALLATION INSTRUCTIONS

1. Inspect the fuel tank in the area in which the rotating screen on top of the engine could contact the fuel tank. If any damage or indication of contact is noted, replace the fuel tank. Order part number 751-0574 (fuel tank) and 726-0209 (cable ties - Qty. 2).

NOTE: The service kit MUST be installed even if the fuel tank


is replaced.

- 2. Make certain the plastic cap is over the end of the pin. Open the hood and insert pin through the hole in the RIGHT side (from operator's position) of fuel tank support bracket. See illustration. Secure with hex sems nut. NOTE: It may be necessary to push fuel tank to the left in order to access the hole in the support bracket. Also, the edge of the frame could partially block the hole in the support bracket so the pin cannot be inserted. If necessary, loosen the two self-tapping screws which secure the fuel tank support bracket, and push the support bracket to the left so the pin can be inserted into the hole. Be certain to retighten the self-tapping screws.
- 3. Affix the green "X" label beside the model plate label, under the seat, to identify that this tractor has been repaired.

Allowable Repair Time Under Warranty:

In Shop Repair - 15 Minutes

In the Field - 1 Hour

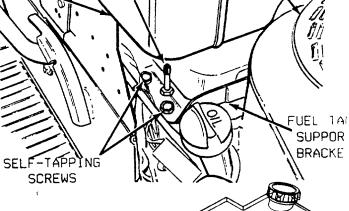

Pln With

PLASTIC CAP

Form No. 770-8812J